
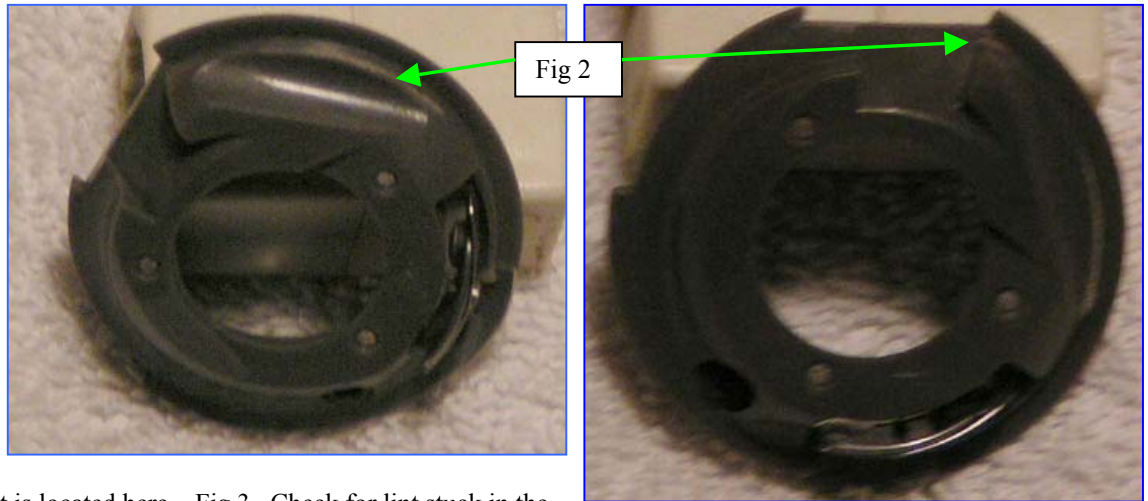


Bobbin winder problems on a 2000:
Winds underneath, or sometimes ok, other times not

Bobbin Case check:

- Check that the bobbin case has a minor gap as shown in Fig 1, green arrow
- The gap should be .010" to .014" (0.25mm – 0.36mm). It is adjustable, but requires removing from the machine.
- If you have it out of the machine, look for wear marks, or grooves cut into the plastic – Fig 2

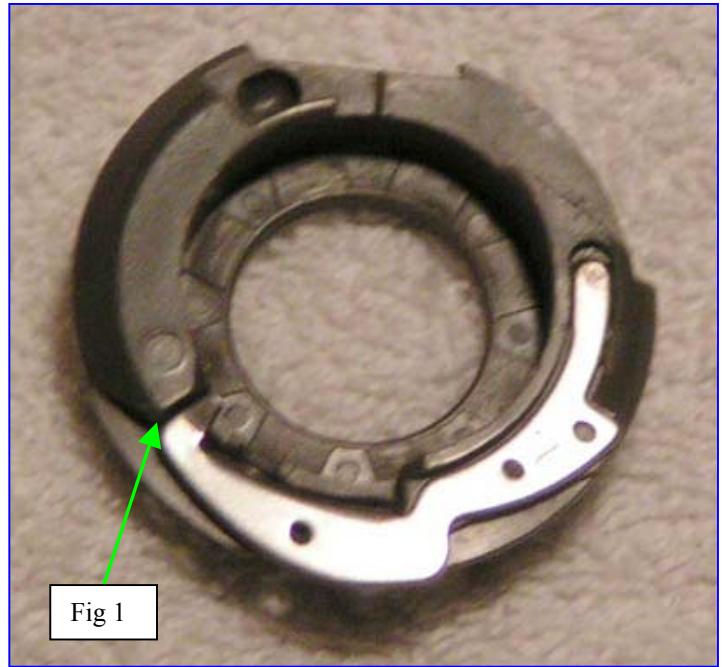

- Tension adjustment is located here – Fig 3. Check for lint stuck in the spring – lift it ever so easy, red arrow side, and just have a look
- This is one of those hooks with a replaceable thread pull off, Fig 4 green arrow part, most of the older machines have it built in, and if it is damaged, or worn, it does require a new hook. I just never had a whole lot of luck in cleaning on up. And they do just wear out, as the thread will cut a notch in the part.

